MELBOURN PARISH COUNCIL

Maintenance Committee Meeting: 18 May 2022

MA014 22a) Rospa report for Clear Crescent Play Park – overview

Items rated at a medium risk level -

Slide embankment with log steps

- top log step is decayed through and loose in ground (could lead to a fall) [10]

ACTION: replace

Agility bars 3 tier

- grass mats are damaged [10]

ACTION: replace

Climber net and ladder (manufacture is unknown)

- fixtures loose or missing [10]

ACTION : net fittings are loose to the posts and remove fittings to check for corrosions and replace if found and secure the net

- Only one post for stability so special attention should be paid to maintenance and if necessary decommissioning item before end of operating life [9]

ACTION: consult manufacture

Multiplay

- Junior caps missing and exposing the thread and bolt missing of ladder guardrail [9]

ACTION: replace caps

Agility Trail 7 element

- bolts loose on Burma bridge [8]

ACTION: Tighten bolts

-Only one post for stability so special attention should be paid to maintenance and if necessary decommissioning item before end of operating life [9]

ACTION: consult manufacture

Space Rocket Chair

-surfacing worn /exposing and damaging liner/Grass and weeds grown inside/ Plastic edging strips are sharp [9]

ACTION: whole area requires immediate repairs and alterations. Bark requires topping up

Cableway

- chain links and seat connector worn [12]

ACTION: replace

-cables should be inspected to see if cables are being worn

ACTION: conduct an appropriate dismantling inspection [11]

- Log rung loose [10]

ACTION: secure